

Basik air concept 2010 RN 97 83340 Le Luc FRANCE <b>Document I-2</b>	<b>SERVICE BULLETIN</b>	N° 050801
	<b>MANDATORY</b>	Date: 16/08/2005 Page 1/1
	TEL: 04 94 99 12 36	FAX:04 94 39 89 37

**EQUIPEMENTS CONCERNED:**

Reference                      Designation                      Serial n° concerned

ADV	ADVANCE HARNESS-CONTAINER	SINCE N° 1100
-----	---------------------------	---------------

**FACTS:**

Several Throw-out pouchs can be too loosed and can generate a non desired extraction of the pilot chute while in free-fall.

**REASONS:**

It looks like the elastic band of the pouch located at the opening mouth of it can be damaged by both bartack sewings. This seems to be the cause of the loosing aspect of the opening mouth of the pouch. Because of this, the pilot chute can be extract easily without any action on it.

**ACTIONS:**

It is mandatory for all Advance harness-container owners to verify the tension of this elastic.  
If the pouch is or seems to be too loose it is mandatory to follow one of these 2 options:

- Sending back to us the container for a free of charge throw out pouch replacement
- Asking us to send to you a new update throw out pouch to be installed by your local certified rigger.

Quality manager

Ludovic Chevé